

Prevention of sunscreen damage

INTRODUCTION

Given the outdoor nature of roofing and walling installations, it is recommended that suitable precautions be taken to prevent personal sun damage. It has been found that certain sunscreens containing semi-conducting metal oxides such as titanium dioxide (TiO₂) and zinc oxide (ZnO) can accelerate the degradation of BlueScope paint systems.

Any corrosion to perforation or paint flaking or peeling caused by sunscreen is not covered by BlueScope's warranties*.

Only organic sunscreens should be used, where there is a chance of contact with COLORBOND® prepainted steel, to minimise the risk of paint degradation.

EFFECT ON PREPAINTED STEEL

Inorganic sunscreen formulations

Clear or nanoparticle inorganic sunscreen formulations are marketed as 'non-whitening' to skin. TiO₂ and ZnO nanoparticles within inorganic sunscreen formulations function as UV absorbers and become 'photocatalysts' producing free radicals. Free radicals can generate sufficient chemical reactions that are very aggressive and can damage paint systems much faster than normal weathering.

Organic sunscreen formulations

Studies indicate that organic sunscreen formulations do not generate sufficient free radicals to be of concern to COLORBOND® steel paint systems. Testing conducted by BlueScope showed organic sunscreen formulations did not cause damage to the prepainted finish of COLORBOND® steel.

RECTIFICATION

Although sunscreen damage is irreversible it will not affect the corrosion performance of the material. The sunscreen affected areas cannot be cleaned and attempts to do so may ultimately impact on the corrosion performance of the material. If aesthetics are a concern, BlueScope recommends that the material be replaced.

Figure 1: Roofing with sunscreen damage.

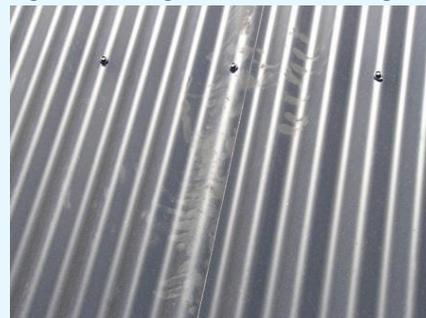


Figure 2: Roofing with sunscreen damage



PREVENTATIVE MEASURES

For personal safety, and to protect the surface of COLORBOND® steel, it is recommended to:

- wear clean, dry, cut-resistant gloves that are suitable for the task;
- take suitable precautions against personal sun damage; and
- prevent contact of the painted surface with sunscreens that contain titanium dioxide (TiO₂) and zinc oxide (ZnO)

steel.com.au

To ensure you have the most current Technical Bulletin

1800 800 789

steeldirect@bluescopesteel.com

If you have any questions regarding this Bulletin, contact Steel Direct



* Warranties are subject to exclusions, application and eligibility criteria. For full terms and conditions and to determine the eligibility of your product for the warranty visit www.bluescopesteel.com.au/warranties or contact Steel Direct. The information and advice contained in this Technical Bulletin ('Bulletin') is of a general nature only and has not been prepared with your specific needs in mind. You should always obtain specialist advice to ensure that the materials, approach and techniques referred to in this Bulletin meet your specific requirements. BlueScope Steel Limited makes no warranty as to the accuracy, completeness or reliability of any estimates, opinions or other information contained in this Bulletin and to the maximum extent permitted by law, BlueScope Steel Limited disclaims all liability and responsibility for any loss or damage, direct or indirect, which may be suffered by any person acting in reliance on anything contained in or omitted from this Bulletin. COLORBOND®, BlueScope and the BlueScope brand mark are registered trademarks of BlueScope Steel Limited. © 2019 BlueScope Steel Limited ABN 16 000 011 058. All rights reserved.